

## AG28 CRANK ASSEMBLY REPAIR

AG28 – IN CASE OF NO CLICKING SOUND WHILE CRANKING UMBRELLA  
REASON: PIN, SPRING OR CRANK SYSTEM NEED TO BE REPLACED

TO OPEN CRANK SYSTEM:

- 1) CLOSE CANOPY AND LOOSEN CORD. DO NOT WORK ON UMBRELLA WHEN CORD IS TIGHT. LOOSEN CORD AND PLACE SOMETHING TO HOLD IT DOWN.
- 2) REMOVE HANDLE FROM SOCKET (B) (SOCKET TO OPEN CANOPY)



- 3) POP OUT PLASTIC RING FROM SOCKET (B) WITH A SCREW DRIVER.



- 4) UNSCREW HEX SCREWS FROM EACH SIDE



- 5) SLIP CAP OFF
-



6) SLIP OFF CRANK ASSEMBLY



7) REMOVE TOP SCREW ON CRANK ASSEMBLY.



8) PIN AND SCREW SHOULD BE INSIDE.



9) IF PIN OR SCREW IS BROKEN. SHIP REPLACEMENTS.



10) IF PIN IS MISSING AND LOOSE INSIDE CRANK ASSEMBLY, CRANK ASSEMBLY NEEDS TO BE REPLACED.  
(SOMETHING IS WRONG IF PIN IS NOT HOLDING IN PLACE.)

